


Energy rating and score

This property's current energy rating is E. It has the potential to be C.

<u>See how to improve this property's energy efficiency.</u>

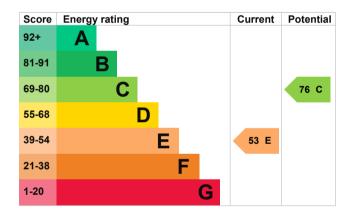

The graph shows this property's current and potential energy rating.

Properties get a rating from A (best) to G (worst) and a score. The better the rating and score, the lower your energy bills are likely to be.

For properties in Northern Ireland:

the average energy rating is D the average energy score is 60

Breakdown of property's energy performance

Features in this property

Features get a rating from very good to very poor, based on how energy efficient they are. Ratings are not based on how well features work or their condition.

Assumed ratings are based on the property's age and type. They are used for features the assessor could not inspect.

Feature	Description	Rating
Wall	Timber frame, as built, insulated (assumed)	Good
Roof	Pitched, 150 mm loft insulation	Good
Window	Fully double glazed	Average
Main heating	Boiler and radiators, oil	Poor
Main heating control	Programmer, TRVs and bypass	Average
Hot water	From main system, no cylinder thermostat	Very poor
Lighting	Low energy lighting in 11% of fixed outlets	Poor
Floor	Solid, insulated (assumed)	N/A
Secondary heating	None	N/A

Primary energy use

The primary energy use for this property per year is 272 kilowatt hours per square metre (kWh/m2).

How this affects your energy bills

An average household would need to spend £828 per year on heating, hot water and lighting in this property. These costs usually make up the majority of your energy bills.

You could **save £388 per year** if you complete the suggested steps for improving this property's energy rating.

This is **based on average costs in 2020** when this EPC was created. People living at the property may use different amounts of energy for heating, hot water and lighting.

Impact on the environment

This property's current environmental impact rating is E. It has the potential to be C.

Properties get a rating from A (best) to G (worst) on how much carbon dioxide (CO2) they produce each year. CO2 harms the environment.

Carbon emissions

An average household produces

6 tonnes of CO2

This property produces	4.7 tonnes of CO2	
This property's potential	2.4 tonnes of CO2	

You could improve this property's CO2 emissions by making the suggested changes. This will help to protect the environment.

These ratings are based on assumptions about average occupancy and energy use. People living at the property may use different amounts of energy.

Changes you could make

Step	Typical installation cost	Typical yearly saving
1. Increase loft insulation to 270 mm	£100 - £350	£16
2. Increase hot water cylinder insulation	£15 - £30	£28
3. Low energy lighting	£40	£46
4. Hot water cylinder thermostat	£200 - £400	£28
5. Heating controls (room thermostat)	£350 - £450	£56
6. High performance external doors	£1,000	£18
7. Condensing boiler	£2,200 - £3,000	£130
8. Solar water heating	£4,000 - £6,000	£44
9. Replacement glazing units	£1,000 - £1,400	£23
10. Solar photovoltaic panels	£3,500 - £5,500	£320

Help paying for energy improvements

You might be able to get a grant from the <u>Boiler Upgrade Scheme (https://www.gov.uk/apply-boiler-upgrade-scheme)</u>. This will help you buy a more efficient, low carbon heating system for this property.

Who to contact about this certificate

Contacting the assessor

If you're unhappy about your property's energy assessment or certificate, you can complain to the assessor who created it.

Assessor's name Ronnie Watson Telephone 07925226876

Email <u>ronnie@eassni.com</u>

Contacting the accreditation scheme

If you're still unhappy after contacting the assessor, you should contact the assessor's accreditation scheme.

Accreditation scheme ECMK

 Assessor's ID
 ECMK302219

 Telephone
 0333 123 1418

 Email
 info@ecmk.co.uk

About this assessment

Assessor's declaration

Date of assessment

Date of certificate

Type of assessment

No related party
10 July 2020
10 July 2020

RdSAP